




换

五轴联动加工中心

MVH1700-5AXIS

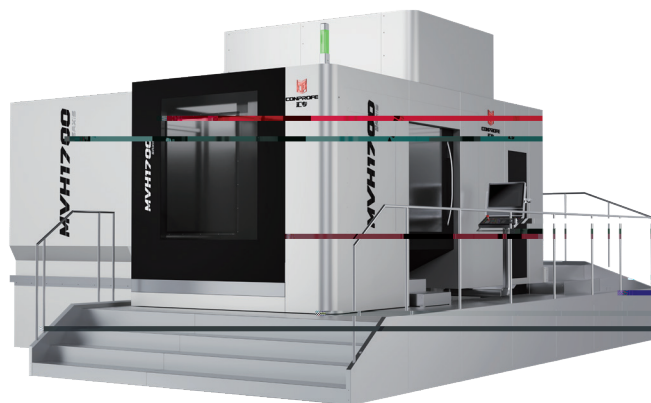

规格参数

标配 选配

ONE

X/Y/Z

mm

2,100 × 2,100 × 1,250

主轴

	mm	HSK-A100
	rpm	10,000
(S1/S6 40%)	kW	50/65
(S1/S6 40%)	Nm	200/240
-	-	(US)

工作台

	mm	Φ1,700
B	°	-30°~180°
C	°	± n × 360°
	kg	8,000
T	pcs-mm	16-22H8
	mm	Φ2,500

刀库

	T	60
/	mm	Φ125/Φ250
	mm	500
	kg	25
-	sec	8 T-T
	-	-

度

X/Y/Z	mm	0.012
X/Y/Z	mm	0.008
B	"	8
C	"	10
B	"	4
C	"	5
(X/Y/Z/B/C)	-	(X.Y.Z)
		(B.C)

电气源要求与整机

	V	380V/50Hz
	kVA	160
	MPa	0.5~0.7
	kg	45,000
× ×	mm	9,720 × 7,120 × 4,850

进给速度

X/Y/Z	m/min	30/20/30
X/Y/Z	m/min	15/10/15
B	rpm	30
C	rpm	12

防护

标准配置


60 (US) RMP60 NC4 + 80 (ATC) LED (RTCP) [()]

选购配置

US+MQL
US+ScCO₂
US+MQL+ScCO₂

机床尺寸图 (单位：mm)

正视图

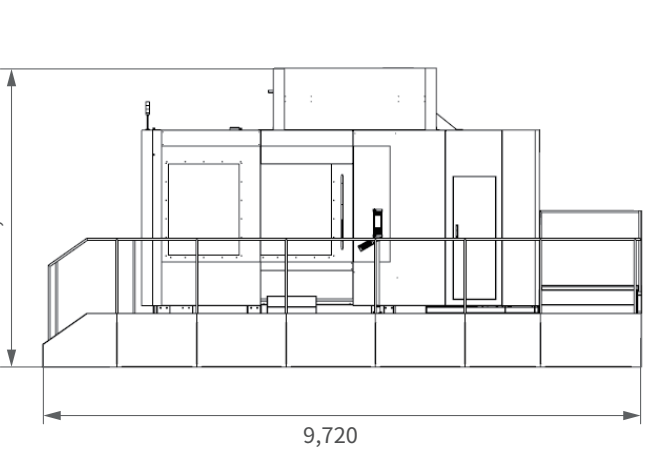

俯视图

